

**SECTION 2  
SITE APPRAISAL**

The Application Site (the site) and its neighbourhood are situated on a hillside of a long sloping terrain which stretches from the Tolo Harbor Road to a few hundred mPD uphill. The Site is located at Tai Po Road - Tai Po Kau Section which is a rural road. The Site is situated in the part of the rural road near the Deerhill Bay development which is a low-density residential development. In the immediate vicinity of the Site are three schools, namely Japanese International School (JIS), Po Leung Kuk Tin Ka Ping Millennium Primary School (TKPM Primary School) and Hong Kong & Kowloon Kaifong Women's Association Sun Fong Chung College (SFCC). **Figure 1** shows the location of the Site and its neighbourhood.



--- Application Site  
Figure 1

Within the application site, there are 1 type of Landscape Resources recorded and described in below table:

Landscape Resources Description	Sensitivity
<p><u>Plantation</u></p> <p>The area consists of 77 nos. of natural trees and most of them are common species, including 46 nos. <i>Leucaena leucocephala</i>, which is an undesirable species that could be excluded from tree compensation according to LAO PN No. 6/2023 issued by LandsD and 5 nos. of Dead Tree. Considering this tree group height ranging from 5m to 13m, crown spread ranging from 1m to 10m, the sensitivity of this tree group is considered as medium.</p>	Medium

Tree Survey was conducted by Mr. Pak Hin Leung (The Arboricultural Association Accredited Arborist: MArborA: PRO5833) on 27<sup>th</sup> Jan, 2022. There are total 77 nos. of trees surveyed within the application site, and among these trees, 10 species were identified within the application site. Please refer to the table below:

Scientific Name	Chinese Name	Quantity (nos.)
<i>Acacia confusa</i>	台灣相思	9
<i>Bombax ceiba</i>	木棉	2
<i>Bridelia tomentosa</i>	土蜜樹	1
<i>Celtis sinensis</i>	朴樹	1
<i>Adenanthera microsperma</i>	海紅豆	4
Dead tree	死樹	5
<i>Ficus microcarpa</i>	細葉榕	6
<i>Leucaena leucocephala</i>	銀合歡	46
<i>Litsea glutinosa</i>	潺槁樹	1
<i>Macaranga tanarius var. tomentosa</i>	血桐	1
<i>Trema tomentosa</i>	山黃麻	1
Total		77

For tree survey details, please refer to **Appendix A** and **Appendix B**.

SECTION 3

ASSESSMENT OF THE POTENTIAL IMPACT TO EXISTING TREES ON SITE

Among 77 trees surveyed, since the proposed development consists of site formation to make the ground floor of the building at level 79.2mPD. All trees within the application site will be affected. 77 trees are proposed to be felled.

Most of the felled trees are not recommended to be transplanted due to several reasons, including poor health, poor structural condition, on steep slope which the root ball cannot be formed, undesirable species or large size which is not feasible to be transplanted and with low survival rate after transplanting. For details, please refer to Appendix B and the table below.

Summary of Trees to be felled

Scientific Name	Chinese Name	Quantity (nos.)
Acacia confusa	台灣相思	9
Bombax ceiba	木棉	2
Bridelia tomentosa	土蜜樹	1
Celtis sinensis	朴樹	1
Adenanthera microsperma	海紅豆	4
Dead tree	死樹	5
Ficus microcarpa	細葉榕	6
Leucaena leucocephala	銀合歡	46
Litsea glutinosa	潺槁樹	1
Macaranga tanarius var. tomentosa	血桐	1
Trema tomentosa	山黃麻	1
Total		77

46 nos. of new trees will be provided within the site<sup>1</sup>. Sufficient space, i.e. 4m spacing will be provided for tree growth. Proposed tree species, sizes, quantity, and location will be further developed. They are 12 nos. located at G/F and 34 nos. on 2/F, for details, please refer to Appendix E.

Proposed new tree planting schedule:

Abbreviation	Botanical name	Chinese name	Height (mm)	Spread (mm)	DBH (mm)	Spacing (mm)	Origin	Quantity
LIQ.FOR.	<i>Liquidambar formosana</i>	楓香	3500	2000	95	4000	Native	7
LLE.ROT.	<i>Ilex rotunda</i>	小果鐵冬青	3500	2000	80	4000	Native	3
TER.MAN.	<i>Terminalia mantaly</i>	小葉欖仁	3500	2000	95	4000	Exotic	25
PLU.RUB.	<i>Plumeria rubra</i>	紅雞蛋花	3500	2000	80	4000	Exotic	7
TAB. CHR.	<i>Tabebuia chrysantha</i>	黃鐘木 (風鈴木)	3500	2000	80	4000	Exotic	4

Note 1: Overall compensatory ratio in terms of number within application site is 1:0.59. Overall compensatory ratio in terms of aggregated DBH within application site is 1:0.36.

SECTION 4

DESIGN CONCEPT AND OBJECTIVES

The proposed development consists of a main landscape area at 2/F and some other landscape area at different levels, including G/F, 7/F, 8/F and R/F. Considering the affected existing Landscape resources mentioned in Section 3, the proposed landscape treatment has been critically reviewed and opportunities for new landscape planting has been maximized, including trees; shrub; groundcover; sensory garden for dementia therapy & aromatic herbs garden. For details, please refer to Appendix E.

4.1 Soft Landscape Design

(i) Ground Floor

Since most of the space within the application site has been reserved for the building footprint, the landscape area is aimed to eliminate visual impact viewing from the adjacent school and outside, enhance the effect by choosing fluffy shrubs and trees will be proposed at the planter along to the Tai Po Road entrance to create pleasant environment and mitigate the visual impact of the Proposed Development.

(ii) 2/F

This portion of the site receives the most sunlight throughout the day and it will be beneficial for vegetation planting. Two set of fitness equipment is proposed for user to exercise under the sunshine. A large number of trees with seasonal changes will be placed to this sensory garden to create an area with lush vegetation to offer a forest like environment for users wandering around under shades with different sensory experience. Visual stimulation as creating mood of color by combine variety height of plantings to attract bees, birds and butterflies; Scents and smell stimulation as natural and placing aromatic plants to evoke intense feelings and trigger emotions; Hearing stimulation as soothing sound from pond of water for relaxing; Tactile Stimulation as pebble walk. Quite a number of vegetables and fruits can be farmed in the garden by easy maintenance and benefits to dementia therapy.

(iii) 7/F & 9/F


The landscape area in this floor is mainly designed for staff supporting, landscape furniture will be placed with aromatic plants as herbs and shrubs in a variety of form and texture to create a relaxing environment for staff to relax.

(iv) 8/F

The Landscape area in this floor is mainly designed for Small Group Homes. Mini-golf and seating areas will be provided with lush vegetation planting at the edge of the building. Mosquito repellent plants as herbs, shrubs and ground cover species in a variety of form and texture to create a relaxing environment for children to explore and hang out.

(v) R/F

The Landscape area in this floor is mainly proposed to increase green coverage and for visual interests.

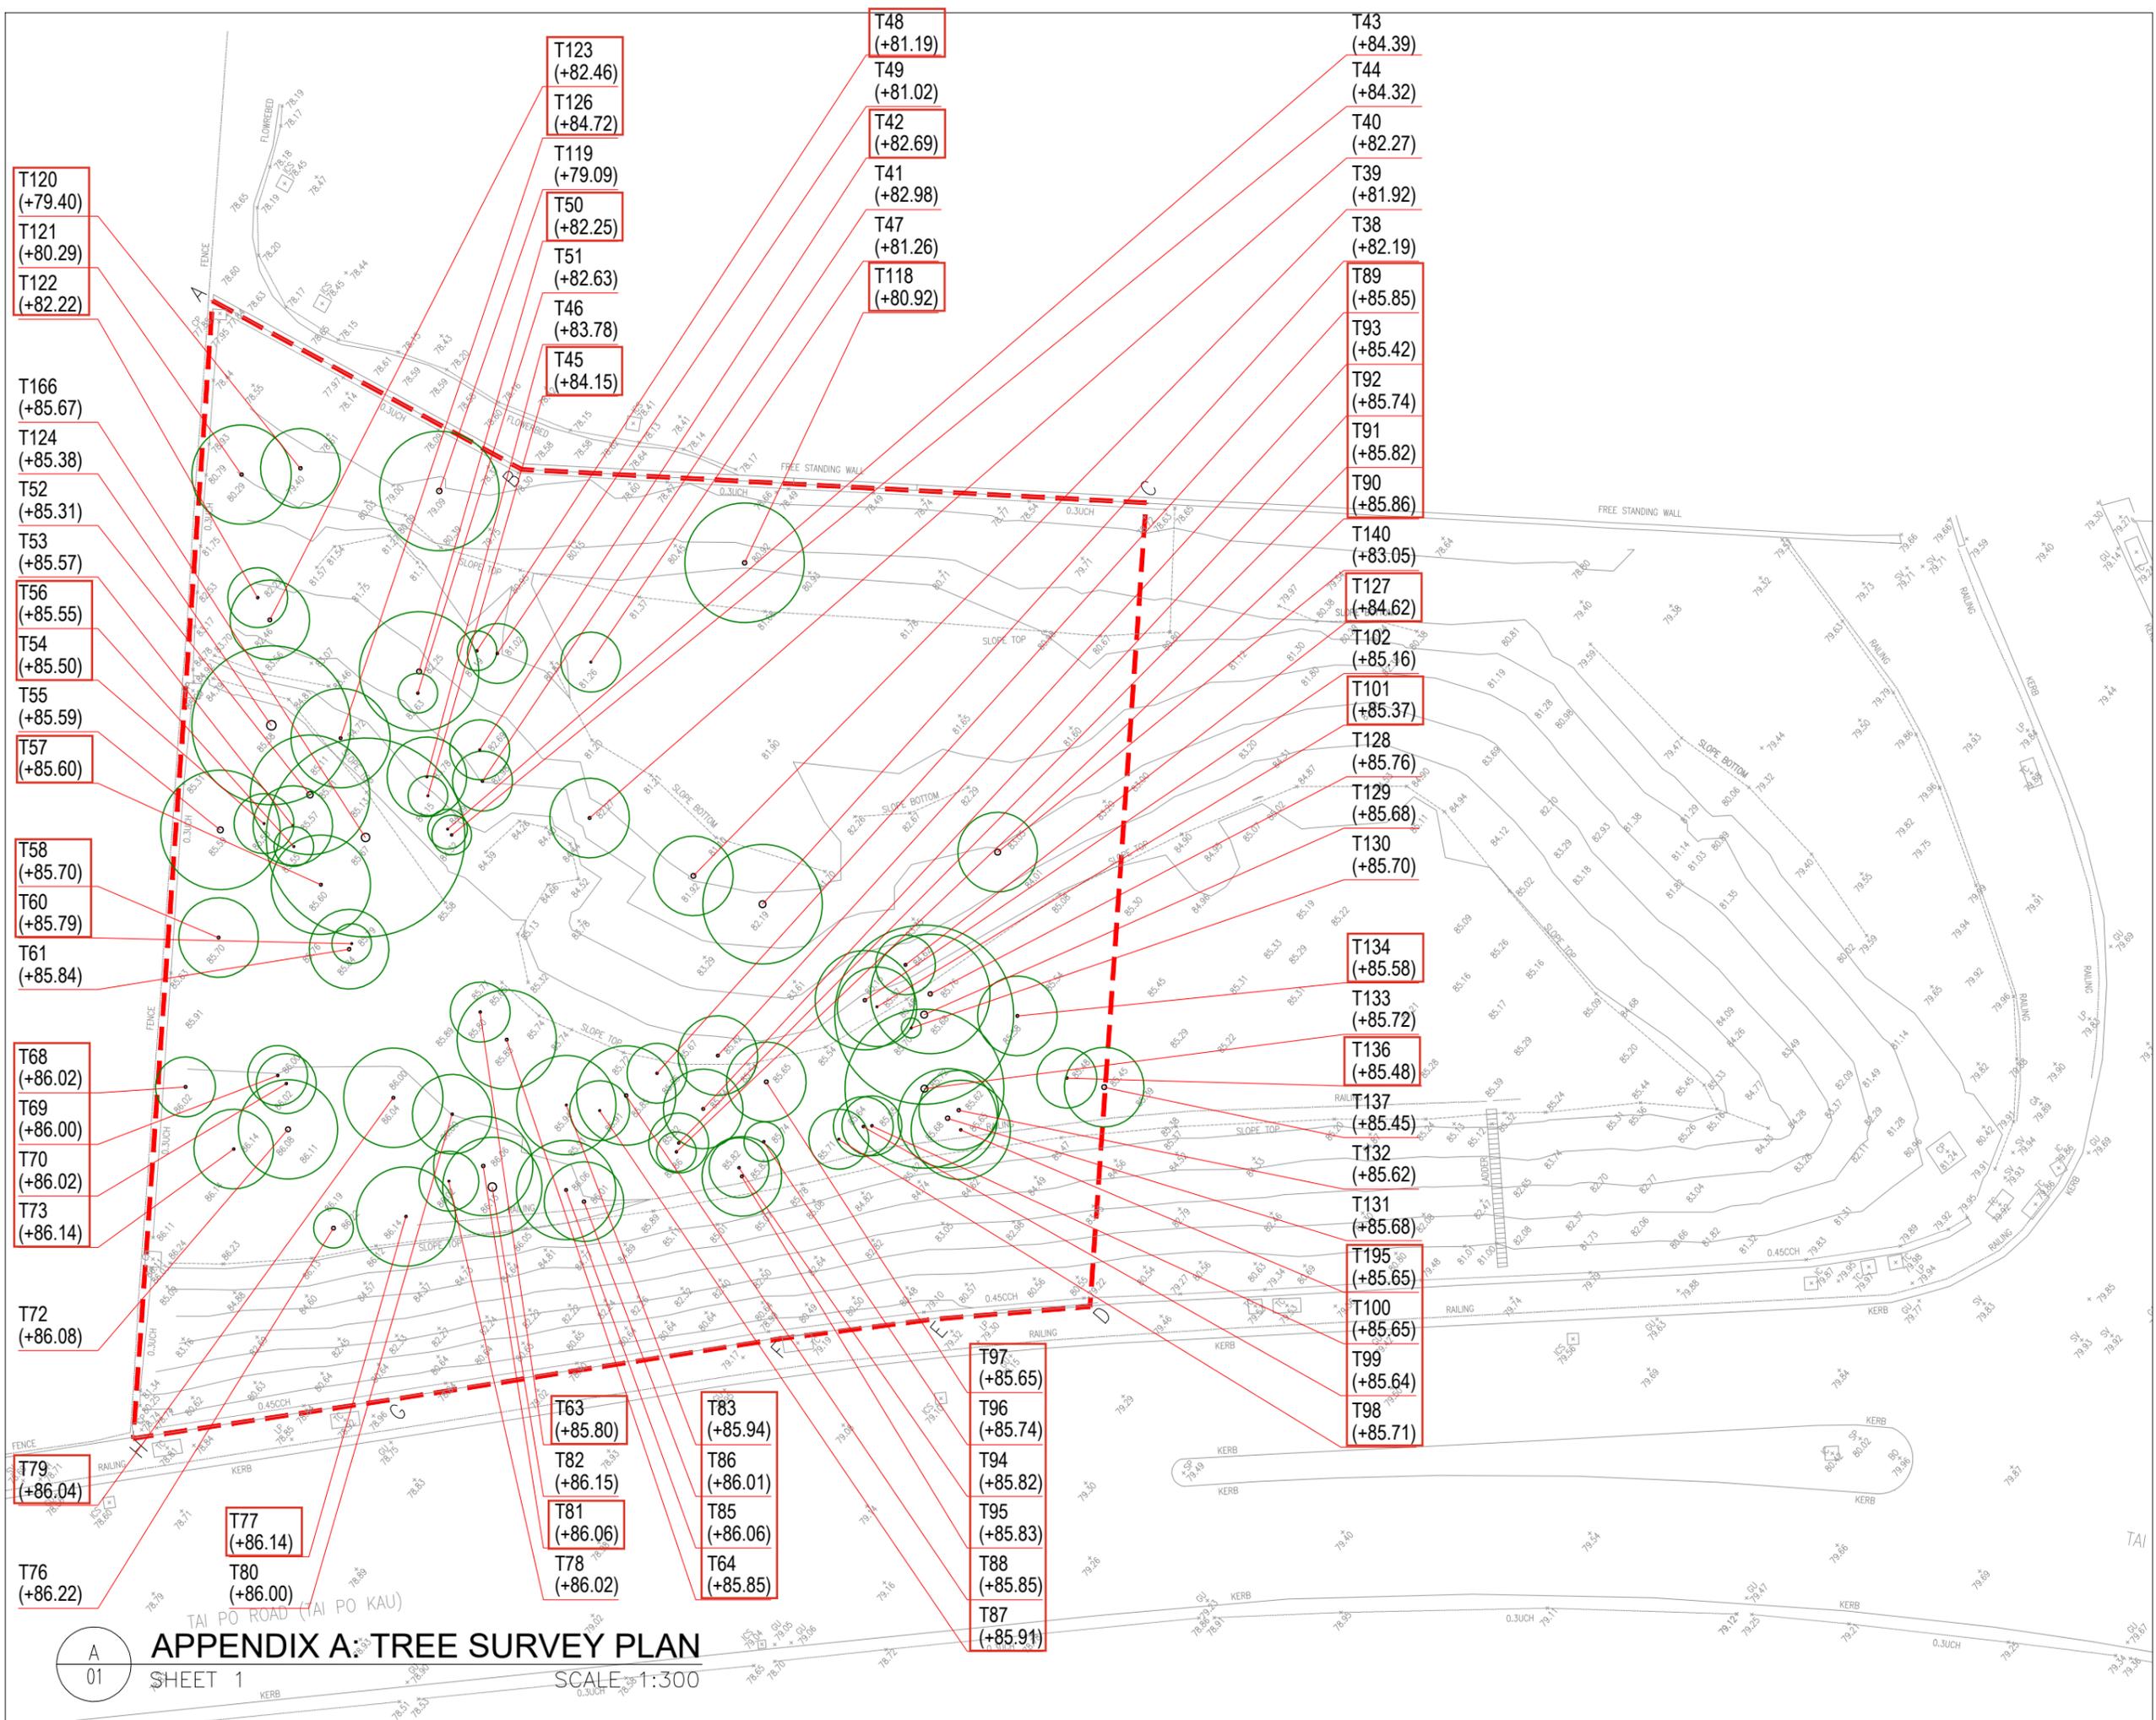

**LEGEND:**

- - - - - SITE BOUNDARY
- T##**  
**(+10.00)** TREE NO. AND EXISTING LEVEL
- SURVEYED TREES (TOTAL 77 nos.)

REV	DATE	DESCRIPTION
0	09 FEB 2022	TPRP

**otherland**

ROOM 2302, 23/F, NEW TECH PLAZA  
34 TAI YAU STREET  
SAN PO KONG KOWLOON, HONG KONG.

Tel: (852) 2893 0270 / 6286 2720  
Fax: (852) 2893 3139  
WWW.OTHERLAND.COM.HK

CLIENT:  
HONG KONG SHENG KUNG HUI WELFARE COUNCIL LIMITED

PROJECT:  
Proposed Hong Kong Sheng Kung Hui St. Christopher's Complex, Tai Po

TITLE:  
TREE SURVEY PLAN (Sheet 1)

SCALE: 1:300	A3
DRAWN BY: L.W. CHAN	
CHECKED BY: YANMI LEUNG	
APPROVED BY: PAUL Y.K. CHAN	
DRAWING DATE: 09 Feb 2022	
PROJECT No: LWK03_21	
SHEET No: LWK03_LP_TSP_01	REV: 0

THIS DRAWING AND DESIGN ARE COPYRIGHTED AND NO PORTION MAY BE REPRODUCED WITHOUT THE PRIOR PERMISSION TO THE LANDSCAPE ARCHITECTS.

**APPENDIX A: TREE SURVEY PLAN**  
SHEET 1 SCALE: 1:300

Address: Remaining Portion of Taxlord Lot No. T77 in DD 34, Tai Po

Lot: T77 in D.D. 34, Tai Po

Prepared by LEUNG Pak Hin on 27th JAN 2022

Field Survey was conducted/updated on 27th JAN 2022

To be read in conjunction with drawing nos. LWK03\_LP\_TSP\_01 rev. 0 and LWK03\_LP\_TTP\_01\_rev. 0

Tree No.	Tree Species		Original Location (Lot/GA/YA/GH BA, etc.)	Tree Size			Form	Health condition	Structural condition	Anticipated Survival Rate after Transplanting (High / Medium / Low)	Top of Soil Level above Root Collar	Proposed Treatment		Additional Remarks	
	Scientific name	Chinese name		Overall height (m)	DBH (mm)	Average crown spread (m)						(Good (G) / Fair (F) / Poor (P))	in initial / approved application		in this revision, if applicable
T038	<i>Adenantha microsperma</i>	海紅豆	DD34TLL T77 RP	13	345	6	F	F	F	L	82.19	Fell	-	-	
T039	<i>Adenantha microsperma</i>	海紅豆	DD34TLL T77 RP	9	230	4	F	F	F	L	81.92	Fell	-	-	
T040	<i>Trema tomentosa</i>	山黃麻	DD34TLL T77 RP	7	140	4	F	F	F	L	82.27	Fell	-	Climber	
T041	<i>Adenantha microsperma</i>	海紅豆	DD34TLL T77 RP	6	110	3	F	F	P	M	82.98	Fell	-	Wound on trunk	
T042	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	100	3	F	F	F	L	82.69	Fell	-	-	
T043	Dead tree	死樹	DD34TLL T77 RP	6	95	2	P	P	P	L	84.39	Fell	-	-	
T044	Dead tree	死樹	DD34TLL T77 RP	5	105	2	P	P	P	L	84.32	Fell	-	-	
T045	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	9	100	2	F	F	F	L	84.15	Fell	-	-	
T046	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	7	101	4	F	F	F	L	83.78	Fell	-	-	
T047	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	5	100	3	F	F	F	L	81.26	Fell	-	-	
T048	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	120	2	F	F	F	L	81.19	Fell	-	Leaning 35°	
T049	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	6	110	3	F	F	F	L	81.02	Fell	-	Climber	
T050	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	9	230	6	F	F	F	L	82.25	Fell	-	Crack on branch	
T051	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	5	110	2	F	F	F	L	82.63	Fell	-	-	
T052	Dead tree	死樹	DD34TLL T77 RP	8	330	6	P	P	P	L	85.31	Fell	-	-	
T053	<i>Bridelia tomentosa</i>	土蜜樹	DD34TLL T77 RP	6	100	4	F	F	F	M	85.57	Fell	-	-	
T054	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	100	3	F	F	F	L	85.50	Fell	-	-	
T055	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	11	290	6	F	F	F	L	85.59	Fell	-	Split branch, dead branch, codominant trunk	
T056	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	100	2	F	P	F	L	85.55	Fell	-	Dieback twigs	
T057	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	130	5	F	P	F	L	85.60	Fell	-	Dieback twigs	
T058	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	140	4	F	P	F	L	85.70	Fell	-	Dieback twigs	
T060	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	9	100	2	F	P	F	L	85.79	Fell	-	Dieback twigs	
T061	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	7	165	4	F	P	F	L	85.84	Fell	-	Dieback twigs	
T063	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	110	3	F	F	F	L	85.80	Fell	-	Cross branch with adjacent trunk	
T064	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	130	5	F	P	F	L	85.85	Fell	-	Dieback twigs	
T068	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	134	3	F	P	F	L	86.02	Fell	-	Dieback twigs	
T069	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	120	3	F	P	F	L	86.00	Fell	-	Dieback twigs	

Address: Remaining Portion of Taxlord Lot No. T77 in DD 34, Tai Po

Lot: T77 in D.D. 34, Tai Po

Prepared by LEUNG Pak Hin on 27th JAN 2022

Field Survey was conducted/updated on 27th JAN 2022

To be read in conjunction with drawing nos. LWK03\_LP\_TSP\_01 rev. 0 and LWK03\_LP\_TTP\_01\_rev. 0

Tree No.	Tree Species		Original Location (Lot/GA/YA/GH BA, etc.)	Tree Size			Form	Health condition	Structural condition	Anticipated Survival Rate after Transplanting (High / Medium / Low)	Top of Soil Level above Root Collar	Proposed Treatment		Additional Remarks	
	Scientific name	Chinese name		Overall height (m)	DBH (mm)	Average crown spread (m)						(Good (G) / Fair (F) / Poor (P))	in initial / approved application		in this revision, if applicable
T070	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	110	3	F	P	F	L	86.02	Fell	-	Dieback twigs	
T072	<i>Ficus microcarpa</i>	細葉榕	DD34TLL T77 RP	9	251	5	F	F	F	L	86.08	Fell	-	-	
T073	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	110	4	F	F	F	L	86.14	Fell	-	-	
T076	<i>Bombax ceiba</i>	木棉	DD34TLL T77 RP	8	180	2	F	F	F	L	86.22	Fell	-	Restrict root	
T077	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	110	5	F	F	P	M	86.14	Fell	-	Leaning 45°	
T078	<i>Adenantha microsperma</i>	海紅豆	DD34TLL T77 RP	6	100	3	F	F	F	M	86.02	Fell	-	-	
T079	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	9	141	5	F	F	F	L	86.04	Fell	-	Broken branch	
T080	<i>Litsea glutinosa</i>	潺槁樹	DD34TLL T77 RP	7	120	4	F	P	F	M	86.00	Fell	-	Dead branch, severe dieback	
T081	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	162	5	F	F	F	L	86.06	Fell	-	Leaning 45°, codominant trunk with included bark, hanger	
T082	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	8	426	5	F	F	F	L	86.15	Fell	-	Multi trunk, included bark, dead branch	
T083	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	95	5	F	F	F	L	85.94	Fell	-	-	
T085	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	140	5	P	F	P	M	86.06	Fell	-	Uproot, leaning 45°	
T086	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	9	160	4	F	P	F	L	86.01	Fell	-	Dieback twigs, leaning 15°, trunk merged with metal fencing	
T087	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	95	3	F	F	F	L	85.91	Fell	-	Leaning 10°	
T088	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	169	5	F	F	F	L	85.85	Fell	-	Included bark, leaning 10°	
T089	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	110	3	F	F	P	M	85.85	Fell	-	Collapsed tree with self-corrected	
T090	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	105	2	F	F	F	L	85.86	Fell	-	Leaning 15°, asymmetric crown	
T091	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	110	3	P	F	P	M	85.82	Fell	-	Exposed root, leaning 20°, asymmetric crown	
T092	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	151	4	P	F	F	M	85.74	Fell	-	Multi trunk, crack trunk, leaning 20°	
T093	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	131	4	F	F	P	M	85.42	Fell	-	Uproot, codominant trunk	
T094	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	120	3	P	F	P	M	85.82	Fell	-	Exposed root, leaning 10°	
T095	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	145	4	P	F	P	M	85.83	Fell	-	Leaning 25°, asymmetric crown, trunk merged with metal fencing	
T096	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	110	2	F	F	F	L	85.74	Fell	-	Exposed root	
T097	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	181	4	P	F	F	M	85.65	Fell	-	Multi trunk, codominant trunk with included bark, hanger	
T098	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	5	100	3	P	F	P	M	85.71	Fell	-	Leaning 45°, uproot, asymmetric crown	
T099	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	118	3	P	F	F	M	85.64	Fell	-	Multi trunk	
T100	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	110	3	P	F	F	M	85.65	Fell	-	Leaning 10°, asymmetric crown	

Address: Remaining Portion of Taxlord Lot No. T77 in DD 34, Tai Po


Lot: T77 in D.D. 34, Tai Po

Prepared by LEUNG Pak Hin on 27th JAN 2022

Field Survey was conducted/updated on 27th JAN 2022

To be read in conjunction with drawing nos. LWK03\_LP\_TSP\_01 rev. 0 and LWK03\_LP\_TTP\_01\_rev. 0

Tree No.	Tree Species		Original Location (Lot/GA/YA/GH BA, etc.)	Tree Size			Form	Health condition	Structural condition	Anticipated Survival Rate after Transplanting (High / Medium / Low)	Top of Soil Level above Root Collar	Proposed Treatment		Additional Remarks	
	Scientific name	Chinese name		Overall height (m)	DBH (mm)	Average crown spread (m)						(Good (G) / Fair (F) / Poor (P))	in initial / approved application		in this revision, if applicable
T101	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	95	4	F	F	F	L	85.37	Fell	-	-	
T102	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	8	170	5	F	F	F	L	85.16	Fell	-	Dead fronds	
T118	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	210	6	F	F	F	L	80.92	Fell	-	-	
T119	<i>Macaranga tanarius var. tomentosa</i>	血桐	DD34TLL T77 RP	6	260	6	F	F	F	L	79.09	Fell	-	-	
T120	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	8	170	4	F	F	F	L	79.40	Fell	-	-	
T121	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	160	5	P	F	P	M	80.29	Fell	-	Abnormal crook trunk, exposed root, restrict root by planter	
T122	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	5	120	3	P	F	F	M	82.22	Fell	-	Leaning 30°, cross branch with adjacent trunk, asymmetric crown	
T123	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	5	187	4	P	F	P	M	82.46	Fell	-	Root-plate movement, leaning 90°, codominant	
T124	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	11	479	8	F	F	F	L	85.38	Fell	-	Cross branch with adjacent trunk, multi trunk, cavity, girdling root, abnormal bark crack	
T126	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	150	5	P	F	F	M	84.72	Fell	-	Asymmetric crown, leaning 15°	
T127	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	6	146	3	F	F	P	M	84.62	Fell	-	Codominant trunk, exposed root, leaning 10°	
T128	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	11	215	6	F	F	F	L	85.76	Fell	-	Exposed root,	
T129	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	10	342	9	P	F	P	M	85.68	Fell	-	Cavity on dead branch, multi trunk, dead branch, cavity on basal trunk	
T130	Dead tree	死樹	DD34TLL T77 RP	7	95	1	P	P	P	L	85.70	Fell	-	-	
T131	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	8	210	5	P	F	F	M	85.68	Fell	-	Asymmetric crown	
T132	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	9	160	4	P	F	F	M	85.62	Fell	-	Leaning 15°, exposed root, asymmetric crown	
T133	<i>Acacia confusa</i>	台灣相思	DD34TLL T77 RP	10	340	8	P	F	F	M	85.72	Fell	-	Codominant, asymmetric crown	
T134	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	130	4	P	F	P	M	85.58	Fell	-	Uproot, leaning 25°, wound on branch, asymmetric crown	
T136	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	7	120	3	F	F	F	L	85.48	Fell	-	-	
T137	<i>Celtis sinensis</i>	朴樹	DD34TLL T77 RP	7	252	4	P	F	P	M	85.45	Fell	-	Exposed root, bark crack, multi trunk, asymmetric crown, epiphytic plant, included bark, cross branch	
T140	<i>Bombax ceiba</i>	木棉	DD34TLL T77 RP	9	300	4	P	F	F	M	83.05	Fell	-	Abnormal crook trunk	
T166	Dead tree	死樹	DD34TLL T77 RP	10	427	10	P	P	P	L	85.67	Fell	-	Codominant	
T195	<i>Leucaena leucocephala</i>	銀合歡	DD34TLL T77 RP	5	120	5	P	F	P	M	85.65	Fell	-	Leaning 55°, uproot	

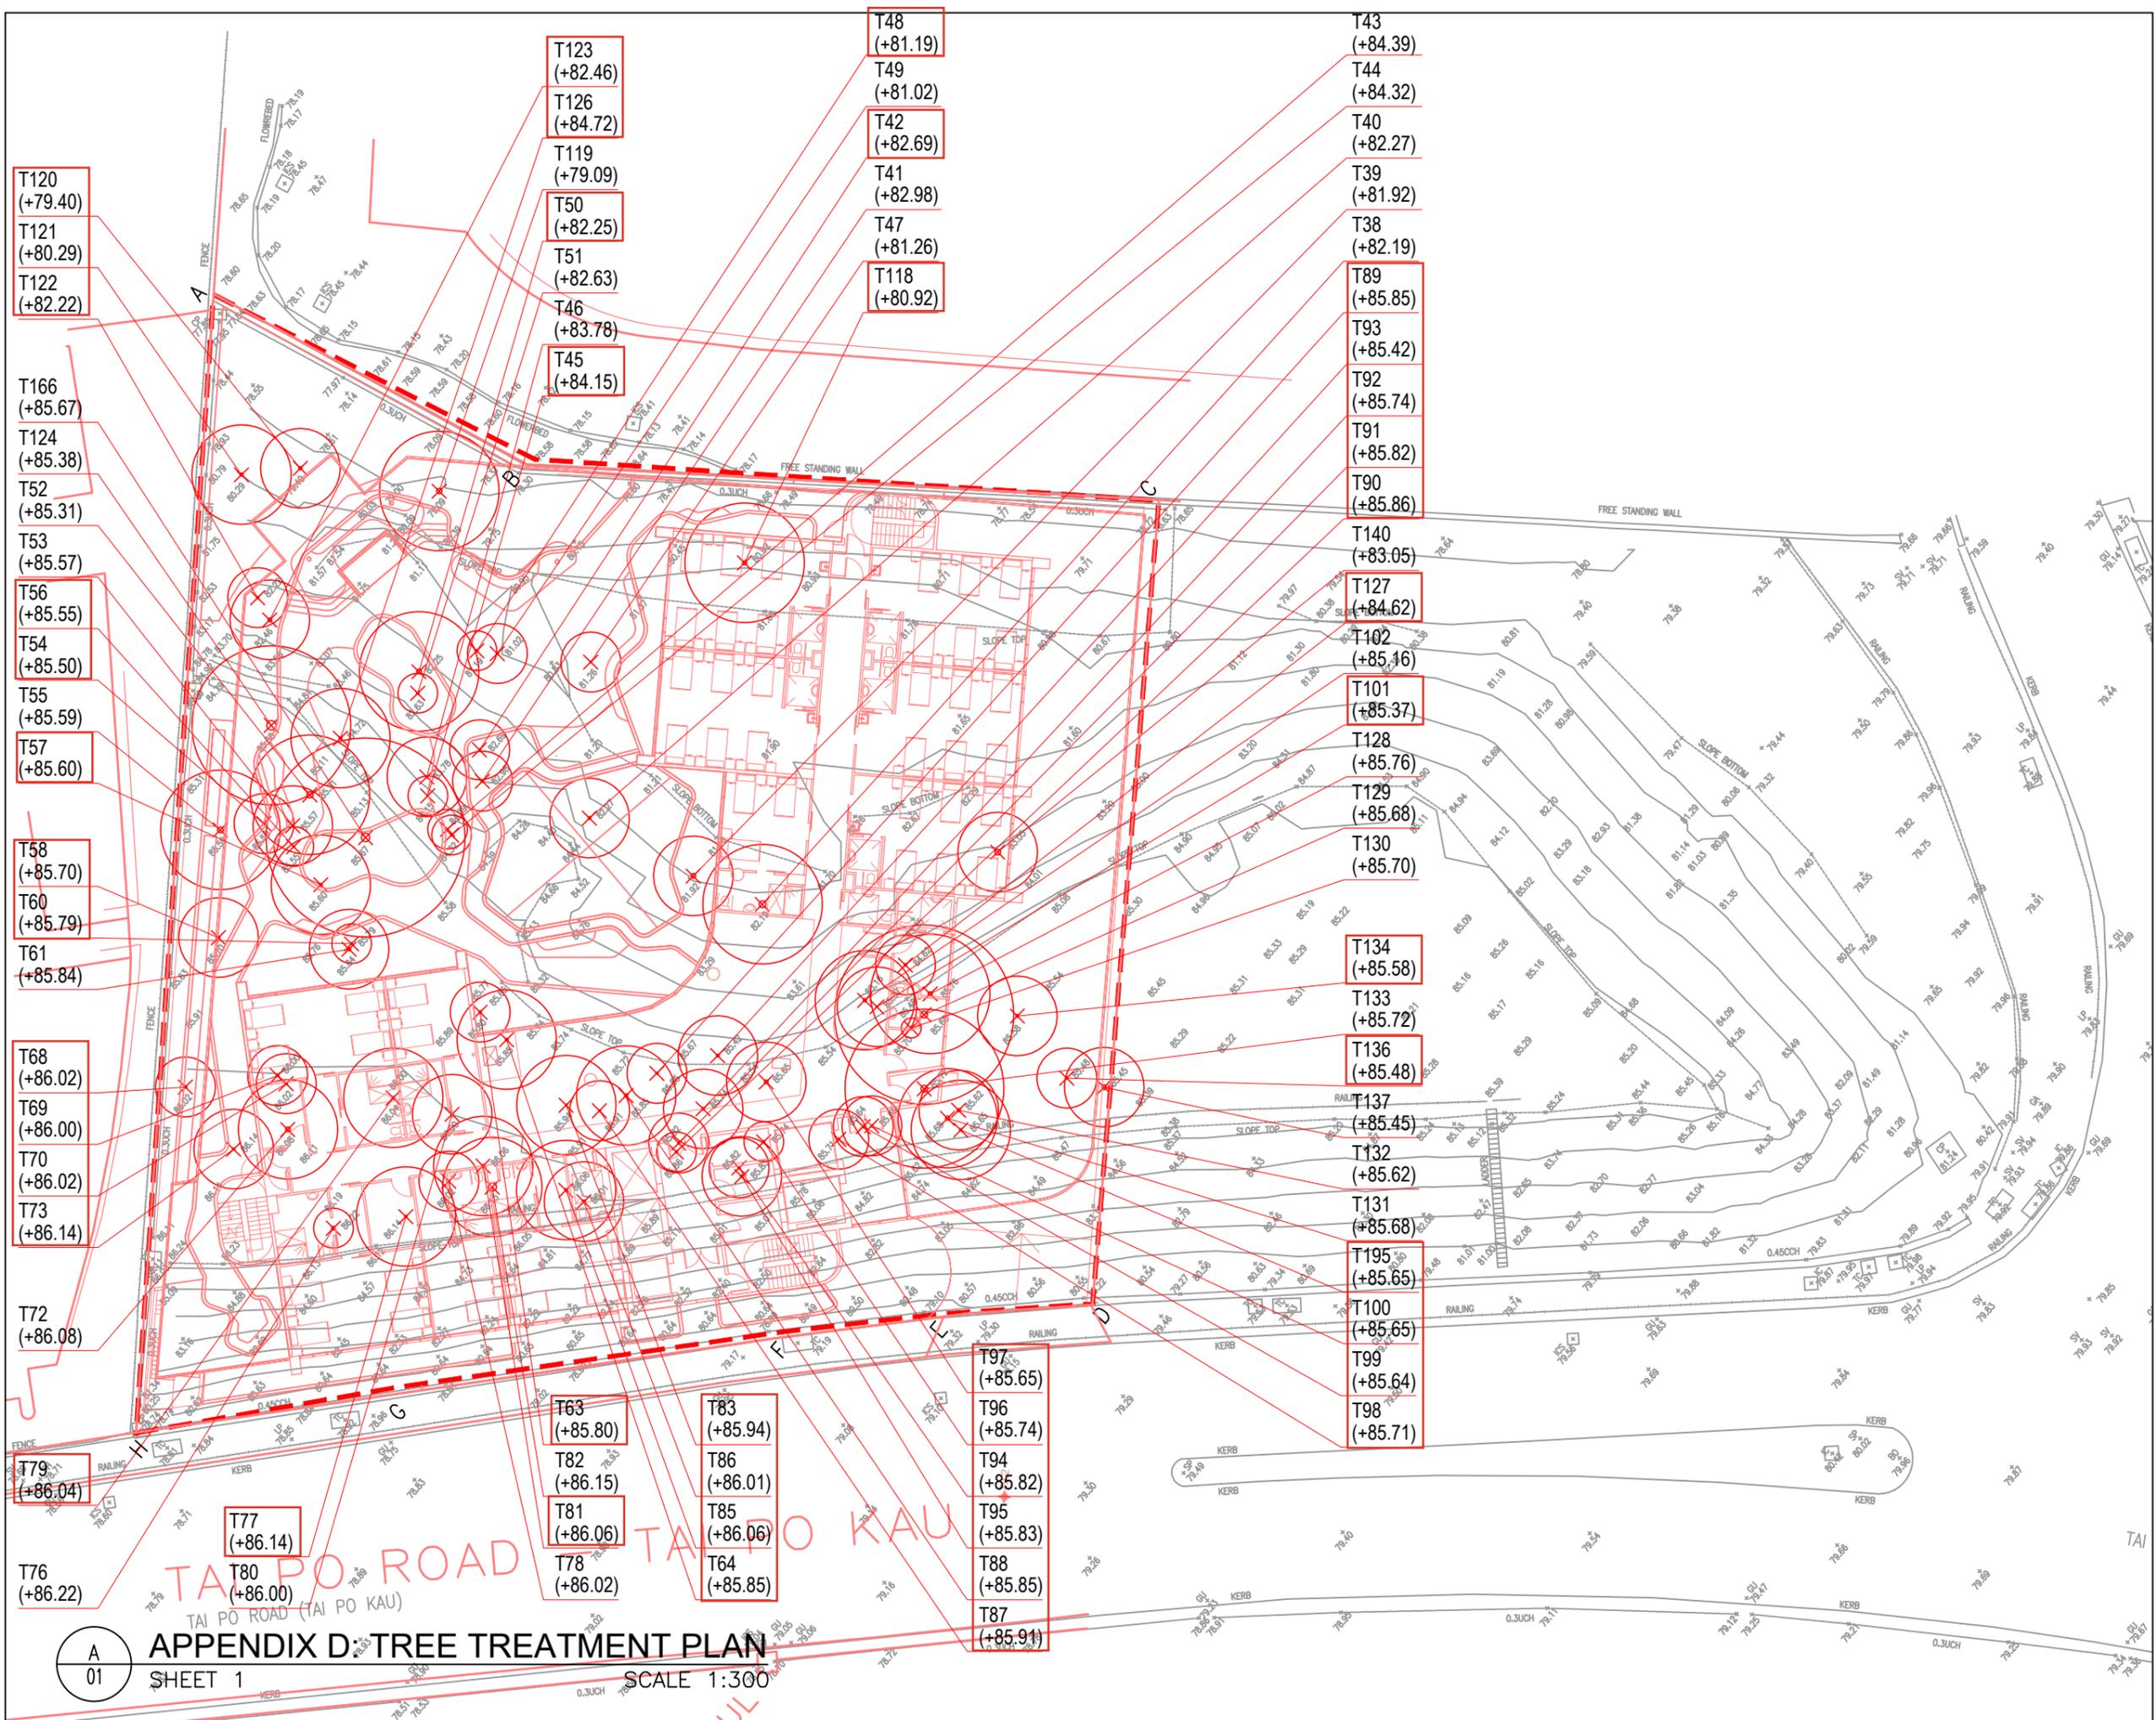

**LEGEND:**

- SITE BOUNDARY
- PROPOSED DEVELOPMENT
- T## (+10.00) TREE NO. AND EXISTING LEVEL
- TREE PORPOSED TO BE RETAINED (TOTAL 0 nos.)
- ⊗ TREE PORPOSED TO BE FELLED (TOTAL 77 nos.)
- △ TREE PORPOSED TO BE TRANSPLANTED (TOTAL 0 nos.)

REV	DATE	DESCRIPTION
0	26 JUN 2024	TPRP

**otherland**

23/F, ON TIN CENTRE  
1 SHEUNG HEI STREET  
SAN PO KONG KOWLOON, HONG KONG,

Tel: (852) 2893 0270 / 6286 2720  
Fax: (852) 2893 3139  
WWW.OTHERLAND.COM.HK

**CLIENT:**  
HONG KONG SHENG KUNG HUI  
WELFARE COUNCIL LIMITED

**PROJECT:**  
Proposed Hong Kong Sheng  
Kung Hui St. Christopher's  
Complex, Tai Po

**TITLE:**  
TREE TREATMENT PLAN  
(Sheet 1)

SCALE: 1:300	A3
DRAWN BY: L.W. CHAN	
CHECKED BY: BRENDAN CHAN	
APPROVED BY: PAUL Y.K. CHAN	
DRAWING DATE: 16 FEB 2024	
PROJECT No: LWK03_21	
SHEET No: LWK03_LP_TTP_01	REV: 0

THIS DRAWING AND DESIGN ARE COPYRIGHTED AND NO PORTION  
MAY BE REPRODUCED WITHOUT THE PRIOR PERMISSION TO THE  
LANDSCAPE ARCHITECTS.

**APPENDIX D: TREE TREATMENT PLAN**  
SHEET 1



SCALE 1:300

A  
01

TAI PO ROAD - TAI PO KAU

**LEGEND**

-  SHRUB PLANTING
-  NEW TREES
-  PEDESTRIAN PAVEMENT
-  VEHICULAR ROAD
-  BENCHES
-  SITE BOUNDARY
-  VEHICULAR ENTRANCE
-  PEDESTRIAN ENTRANCE

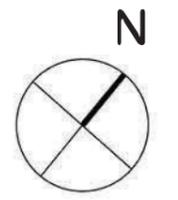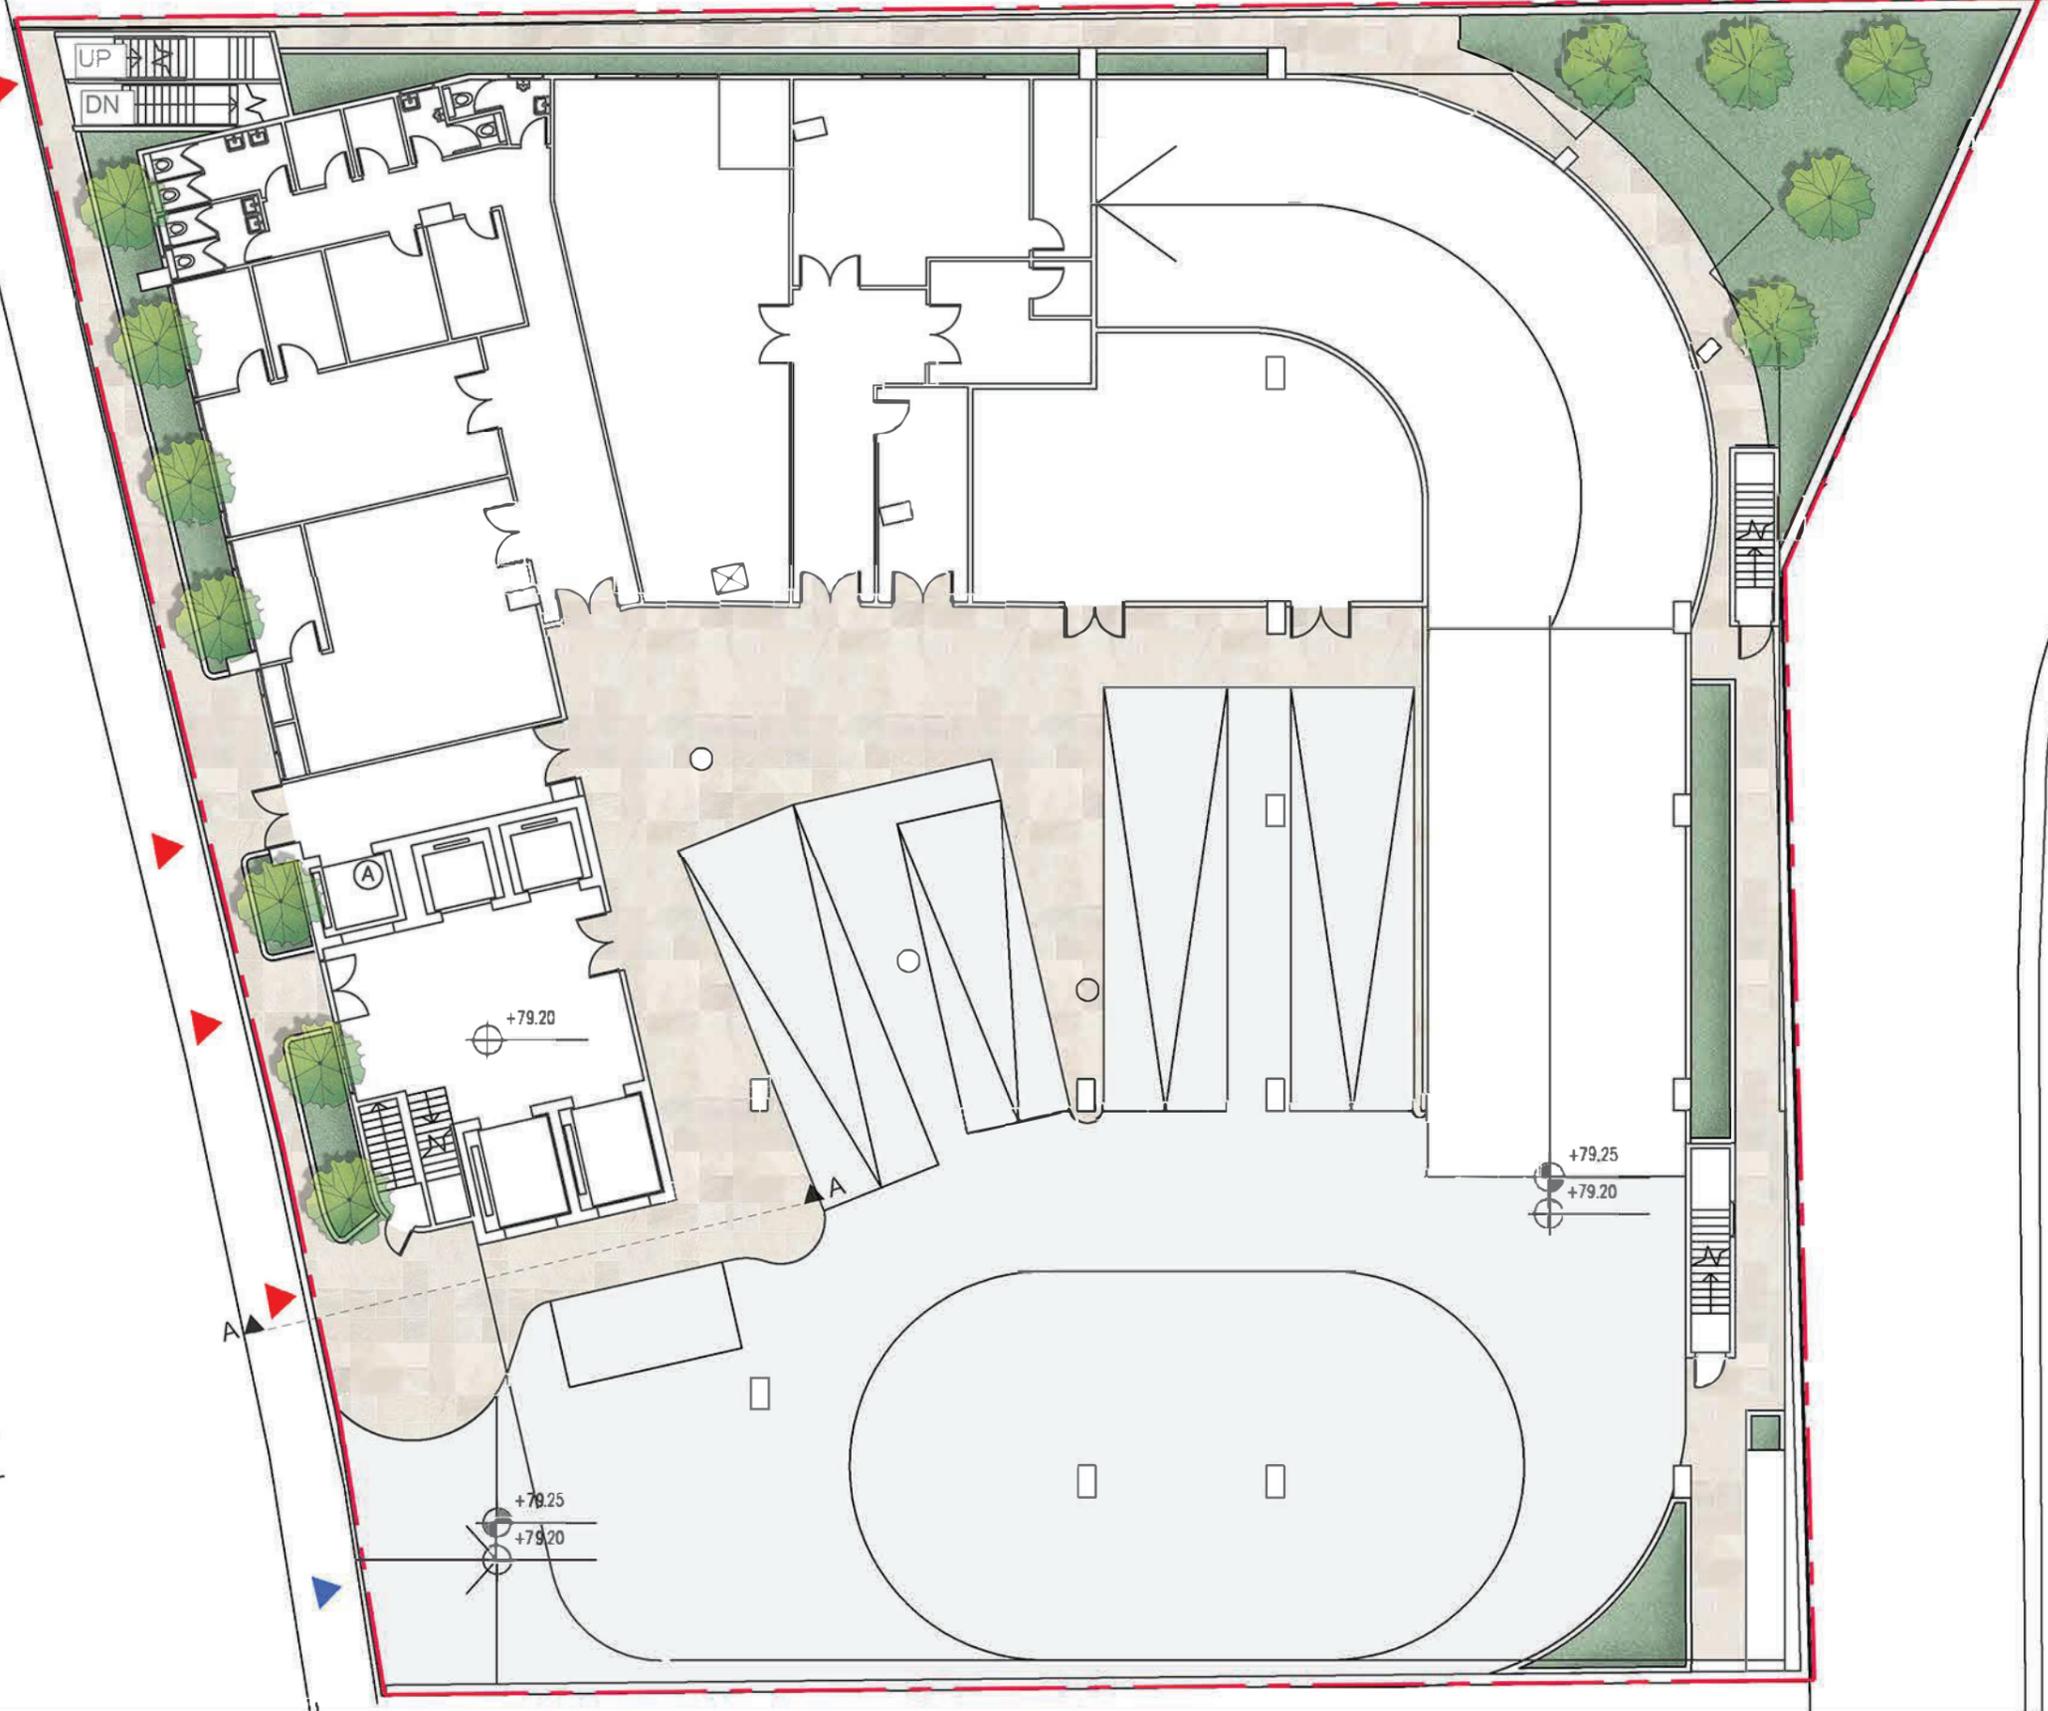

TAI PO ROAD - TAI PO

CUL

**LEGEND**

 SHRUBS PLANTING	 DECK
 NEW TREE	 PAVILION
 HARD PAVED AREA	 PEBBLE WALK
 SITE BOUNDARY	 FARMING BOX
	 BENCH
	 FISHPOND
	 SAFETY MAT
	 FITNESS EQUIPMENT





*Ilex rotunda var. microcarpa*  
小果鐵冬青

*Tabebuia chrysantha (Jacq.) G. Nicholson*  
黃花風鈴木



SECTION B-B



Key Plan (N.T.S.)

